


7. Cable ties are supplied to secure the auxiliary leads or cable to one of the main power cables. Leave slack or loop in leads to Powerpole contacts when applying cable ties, figure1. Wraps to be placed approximately 1 inch (25.4mm) apart as shown in figure 1.

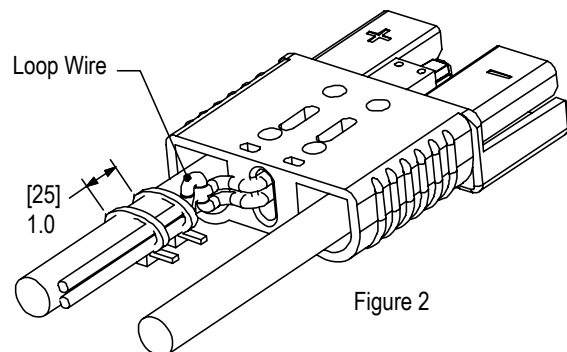

8. To remove auxiliaries, punch out pins from bottom with .06 inch (1.5mm) diameter steel rod or pin driver. Also available: contact insertion-extraction tool kit (cat. #111038G2).

WARNING
UTMOST CAUTION SHOULD BE USED WHEN WORKING ON LIVE CONNECTOR CONTACTS

UL and CSA Reference - These connectors are recognized under the component program of Underwriters' Laboratories, File E26226, as well as Canadian Standards Association, Report LR25154.

PATENTS AND TRADEMARKS

This product is covered by the following patents: U.S. 3,794,957; U.K. 1,443,819; France 73,44153; Italy 1,000442; Japan 885,802; South Africa 74/0939; Canada 990,821. Other U.S. and foreign patents pending.

"SBX, Powerpole and Anderson Power Products" are registered U.S. and foreign trademarks of Anderson Power Products, 13 Pratts Junction Road, P.O. Box 579, Sterling, MA 01564 USA



HEADQUARTERS: 13 Pratts Junction Road, P.O. Box 579, Sterling, MA 01564 T:978-422-3600 F:978-422-3700

EUROPE: Rathealy Road, Fermoy Co. Cork, Ireland T:353-(0)25-32277 F:353-(0)25-32296

ASIA/PACIFIC: IDEAL Anderson Asia Pacific Ltd., Unit 922-928 Topsail Plaza, 11 On Sum Street, Shatin N.T., Hong Kong
T:852-2636-0836 F:852-2635-9036

CHINA: IDEAL Anderson Technologies (Shenzhen) Ltd., Block A8 Tantou W. Ind. Par, Songgang Baoan District, Shenzhen, PR. China 51810
T: 86-755-2768-2118 F: 86-755-2768-2218


TAIWAN: IDEAL Anderson Asia Pacific Ltd., Taiwan Branch, 4F-2, No.116, Dadun 20th St., Situn District, Taichung City 407, Taiwan (R.O.C.)
T: 886-4-2310-6451 F:886-4-2310-6460

www.andersonpower.com

SBX® Connectors

Assembly instruction for SBX®175 and SBX®350 Series
two pole battery connector with option for two auxiliary contacts.

Contains one (1) housing and two (2) contacts.

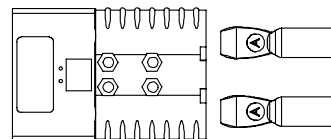

FOR INSTALLATION BY A QUALIFIED ELECTRICIAN IN ACCORDANCE WITH NATIONAL AND LOCAL ELECTRICAL CODES AND THE FOLLOWING INSTRUCTIONS. THE SUITABILITY OF THIS TYPE OF TERMINATION MUST BE EVALUATED BY UNDERWRITERS' LABORATORIES, INC. AND CANADIAN STANDARDS ASSOCIATION FOR THE END USE APPLICATION.


Assemble contacts to the cables according to the equipment manufacturer's assembly instructions. The following instructions are supplied as a reference. Please note: instructions are included with each crimp tool for terminating specific contacts.

- CONNECTOR RATINGS**
SBX350 series: 350 AMPS with max cable size 300MCM
SBX175 series: 175 AMPS with max cable size 1/0

2. RECOMMENDED CONTACT CRIMPING

RECOMMENDED CRIMP OUTLINE:

Connector Series	Contact	Portable Hydraulic Tool	Pneumatic Tool
SBX350	2/0, 3/0, 4/0, 300MCM	1368	1387G1 & 1387G2



- REDUCING BUSHINGS:** recommended for fitting small cables to STD contacts assuring proper crimp connection

Connector Series	Bushing Size (AWG)	Catalog Number
SBX350	2/0 to 1/0	5918
SBX175	1/0 to 1	5687
	1/0 to 2	5690
	1/0 to 4	5693
	1/0 to 6	5663
	1/0 to 10	5648

CAUTION:


When using cable with jacket diameter less than 0.423 inches (11mm) on the SBX175 and less than 0.709 inches (18mm) on the SBX350 thin wall heat shrink insulation should be evenly applied across the cable and contact barrel junction to insure finger protection.

Heat Shrink Insulation Specifications

Connector Series	Nominal Tubing Size	Minimum Length	Maximum Wall Thickness
SBX350	.75 in (19mm)	2.0 in (51mm)	.030 in (.76mm)
SBX175	.50 in (12.7mm)	2.0 in (51mm)	.025 in (.63mm)

4. CABLE STRIPPING DIMENSIONS

Connector Series	Strip "X" To Inches	To mm
SBX350	1 3/8	35
SBX175	1 1/8	29

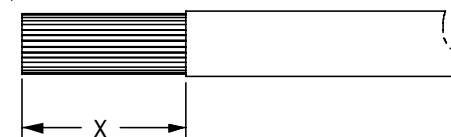

5. **RECOMMENDED SOLDERING TECHNIQUES**
(Use rosin flux solder only). Wrap cable strands, melt solder into well; heat and insert stripped cable. Continue heating well until solder flows into wire being careful not to over flow onto contact surfaces. DO NOT SOLDER DIP CONTACTS when contacts are soldered to unsupported lead. Underwriters' Laboratories, Inc. requires use of cable clamps, listed in table below.


6. **CABLE / CONTACT & HOUSING ASSEMBLY**
Observing polarity of markings, push each contact into rear of housing until notched side snaps over spring, tug on cable to make sure contact is locked into place.

DISASSEMBLING SBX CONNECTORS (see illustration)

Switch off power first. Remove contact by inserting extraction tool (cat. no. SBX175 - 969P1, SBX350 - 970P1) as shown below (steps 1, 2, & 3).

CAUTION: Replace contacts individually on battery leads to reduce potential danger of shorting.

1. Insert extraction tool as shown between contact and housing to point A.

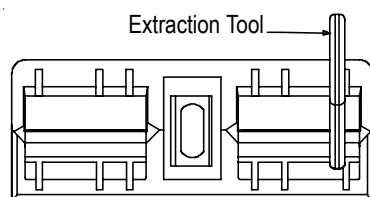

2. Press down to release contact from spring.
3. Pull cable to remove contact.

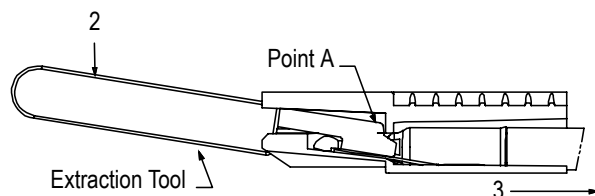



Table A

Connector Ampere Rating	For Two Single Conductor Cables
SBX350	911G2
SBX175	945G2


SBX® Auxiliary Contact Assembling Instructions

Catalog Number	Application	Contact	Wire Size	Pin Length
6344	SBE80, SBE160, SBO60, SBX175	1331	#12/16	0.85
6305G1	SBE320, SBX350	1331	#12/16	1.00
6310G1	SBE320, SBX350	1332	#16/20	1.00

Contains two each of: housings, contacts, retaining pins, & cable ties.

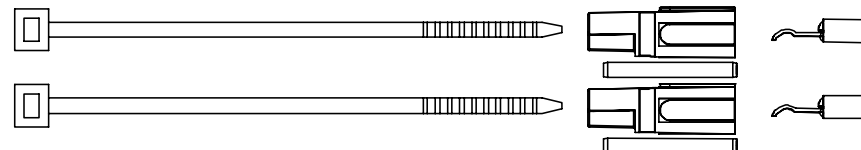

1. Single conductors use #12 to #18 AWG wire only. Strip to 0.31 inch (7.9mm) off end of insulation.

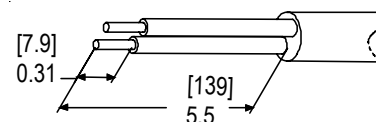

2. Twin conductor cable #12 to #18. Strip back outer jacket 5.50 inches (139 mm). (See illustration). Then strip conductor insulation as in 1.

- 3a. To crimp: use the recommended tool. Crimping by other means may disturb contact position in housing and or produce high resistance joints.

Crimp Tool	Catalog Number
Manual - cycle controlled	1309G2
Pneumatic - cycle controlled	1367G1

- 3b. To Solder: Not recommended.
4. Thread or push one or two auxiliary contacts and wires through the rear of the SBX connector before inserting into auxiliary housings. Push into auxiliary housings through rear until notched side of contact tip snaps over spring. Tug wires to make sure wires are secure.
5. Slide two auxiliary Powerpole housings together by dovetails to stack vertically. They cannot be inserted separately into SBX housing. The rear of each of the Powerpoles housings must be flush.
6. Slide tacked auxiliaries back into SBX connector housing until seated. The male dovetail should be on top as shown in figure 1. Make sure side grooves of auxiliaries are aligned for retaining pins B insert tubular pins. Hammer pins in holes from top, as shown in figure 1.

