


Circuit Protection Terminals


Warning:

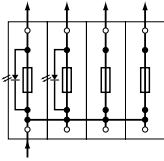

- Install ZAP TNHE fuse cover plate after last ZSI 2.5/2.
 - Disconnect power before replacing the fuse.
- Fuse terminals are available with LED blown fuse indicators, which speed identification of fuse failures and

reduce costly down time. The maximum operating voltage for the indicator fuse blocks is determined by the LED's rating. A 2 mA residual current passes through the LED when the fuse is blown. Opening the fuseholder eliminates the residual current.

ZSI 2.5/2

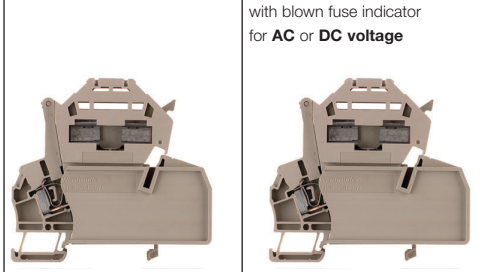

Single Level
1 1/4 x 1/4 fuse

with blown fuse indicator
for AC or DC voltage

Single Level
1 1/4 x 1/4 fuse

Terminal Block Selection Data

Available Options	Version	Part No.	Part No.
	Beige Wemid	1616460000	10-36 VDC/AC 1616470000
	Beige Wemid		30-70 VDC/AC 1616480000
	Beige Wemid		60-150 VDC/AC 1616490000
	Beige Wemid		60-150 VDC/140-250 VAC 1616500000

Dimensions

Width / Length / Height mm (in.)	with TS 35 x 7.5	12/79/74 (.47/3.11/2.9)	12/79/74 (.47/3.11/2.9)
Insulation stripping length	mm (in.)	10 (.39)	10 (.39)

Technical Data

Rated voltage / rated current / wire size	UL	600 V / 16 A / #26...12 AWG	600 V / 16 A / #26...12 AWG
	CSA	600 V / 15 A / #26...12 AWG	600 V / 15 A / #26...12 AWG
	VDE	500 VAC / 10 A / 2.5 mm ²	500 VAC / 10 A / 2.5 mm ²

Selected Accessory Data[†]

End Plate (ZAP)	Type	Part No.	Type	Part No.
Beige Wemid	ZAP TNHE/ZSI 2.5	1610840000	ZAP TNHE/ZSI 2.5	1610840000
Blue Wemid				
Orange PA				

Jumpers

Note: Final number in model indicates no. of poles (e.g. ZQS 2.5/2 = 2 poles).

ZQS 2.5/2	1633200000	ZQS 2.5/2	1633200000
ZQS 2.5/3	1633210000	ZQS 2.5/3	1633210000
ZQS 2.5/4	1633220000	ZQS 2.5/4	1633220000
ZQS 2.5/5	1633230000	ZQS 2.5/5	1633230000

Disconnect Lever Accessories

Solid brass slug [†]	SBL	0446300000	
Plastic strip for ganging levers**	Sch S2	0337400000	Sch S2 0337400000

Tools

Screwdriver	SD	9008330000	SD 9008330000
-------------	----	-------------------	----------------------

Fuse Cartridges 1 1/4 x 1/4

Rated current (A): 0.5	E 0.5A	0533800000	E 0.5A	0533800000
1	E 1A	0525500000	E 1A	0525500000
2	E 2A	0294500000	E 2A	0294500000
3	E 3A	0295700000	E 3A	0295700000
5	E 5A	0294600000	E 5A	0294600000
7	E 7A	0295800000	E 7A	0295800000
10	E 10A	0293900000	E 10A	0293900000

Marking Tags

	Print	DEK 5/5	0473460001	DEK 5/5	0473460001
Consecutive horizontal		DEK 5/5	0473460001	DEK 5/5	0473460001
Consecutive vertical		DEK 5/5	0473560001	DEK 5/5	0473560001

Note: Part numbers shown are for a single card of pre-printed tags numbered 1-50. For additional information, see Accessories section.

**Provided in one meter strips.

[†]Hollow brass slug (Part No. **2012750000**) also available.

[‡]See Accessories section for additional information.

Note: 1) For 13/32 x 1 1/2 fuses, use SAKS 4 (Part No. **0178220000**), ratings 600 V / 30 A / #20...8 AWG, screw clamp.

2) When jumpering ZSI blocks, remove jumper knock-out before inserting the jumper using a screwdriver blade.